


## ONX-W09\_SectionA-A\_newholes.pdf

This detail shows the new hole layout to put through ONX-W23-03R/L, ONX-W23-07, and ONX-W10-03R/L to achieve correct alignment between joint rib and the rear spar. Qty 8 new hole layout is in black.

Other option is to remake the ONX-W10-03R and -03L per the detail provided on print ONX-W10 and leave out the interfacing holes with the aft rib and aft rib doubler.

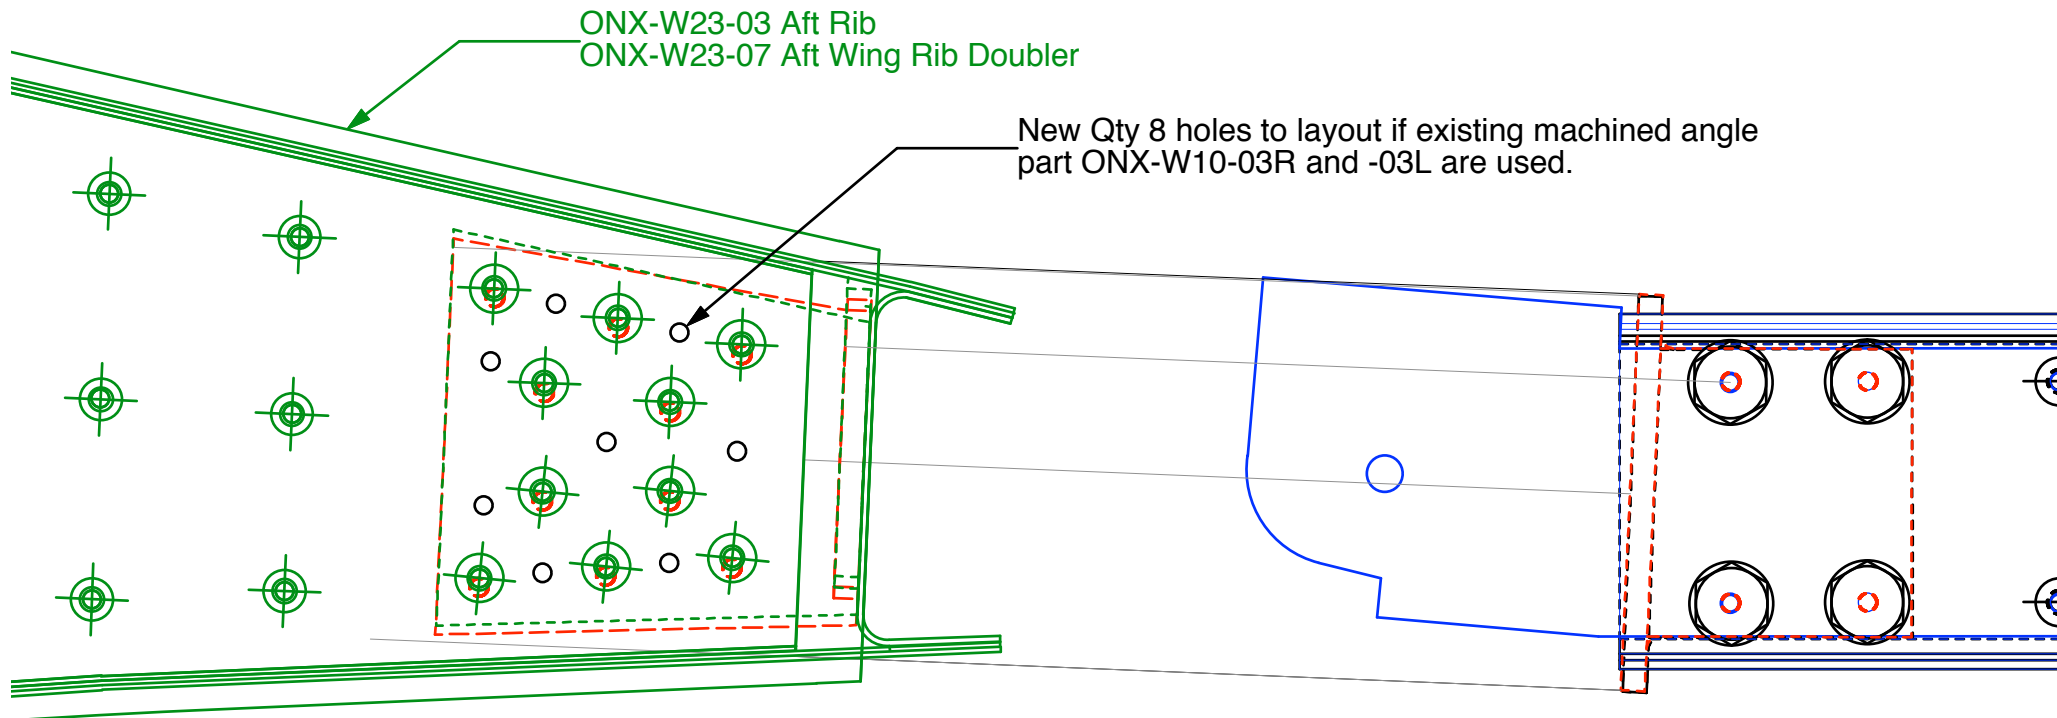

ONX-W09 Section A-A (Rib #6) in Green.  
ONX-W10-03R Part in Red  
Incorrect hole alignment shown with green holes not aligning with red holes.

ONX-W10-01R Assembly in Blue.  
ONX-W10-03R Part in Red  
This assembly is correct