

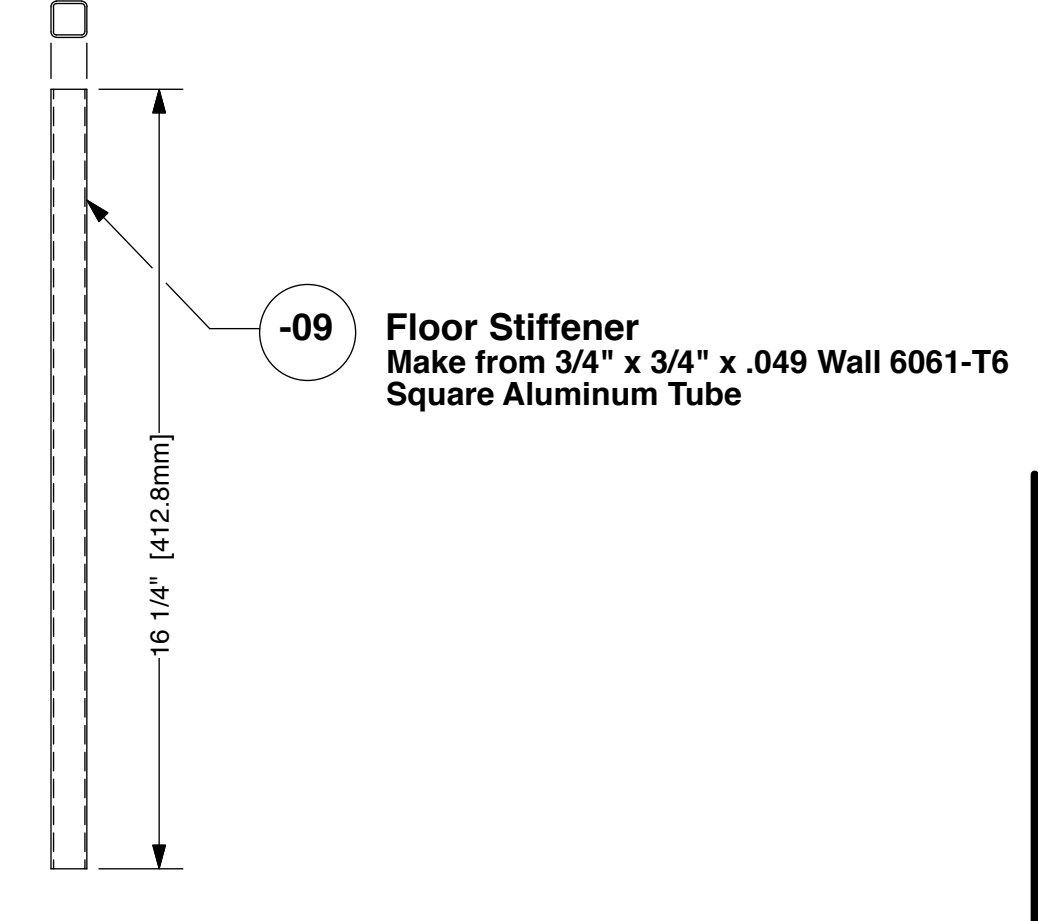
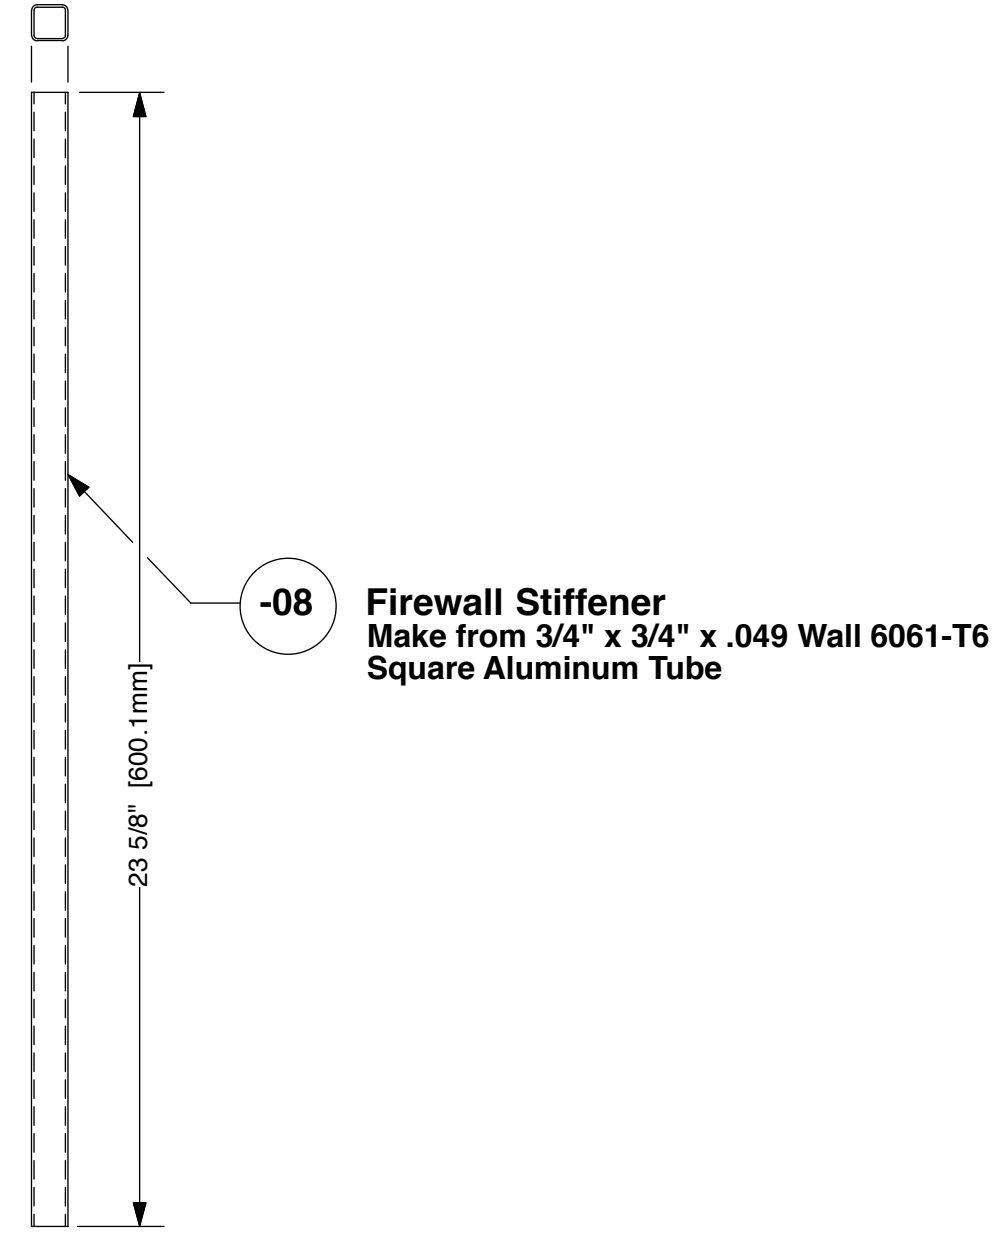
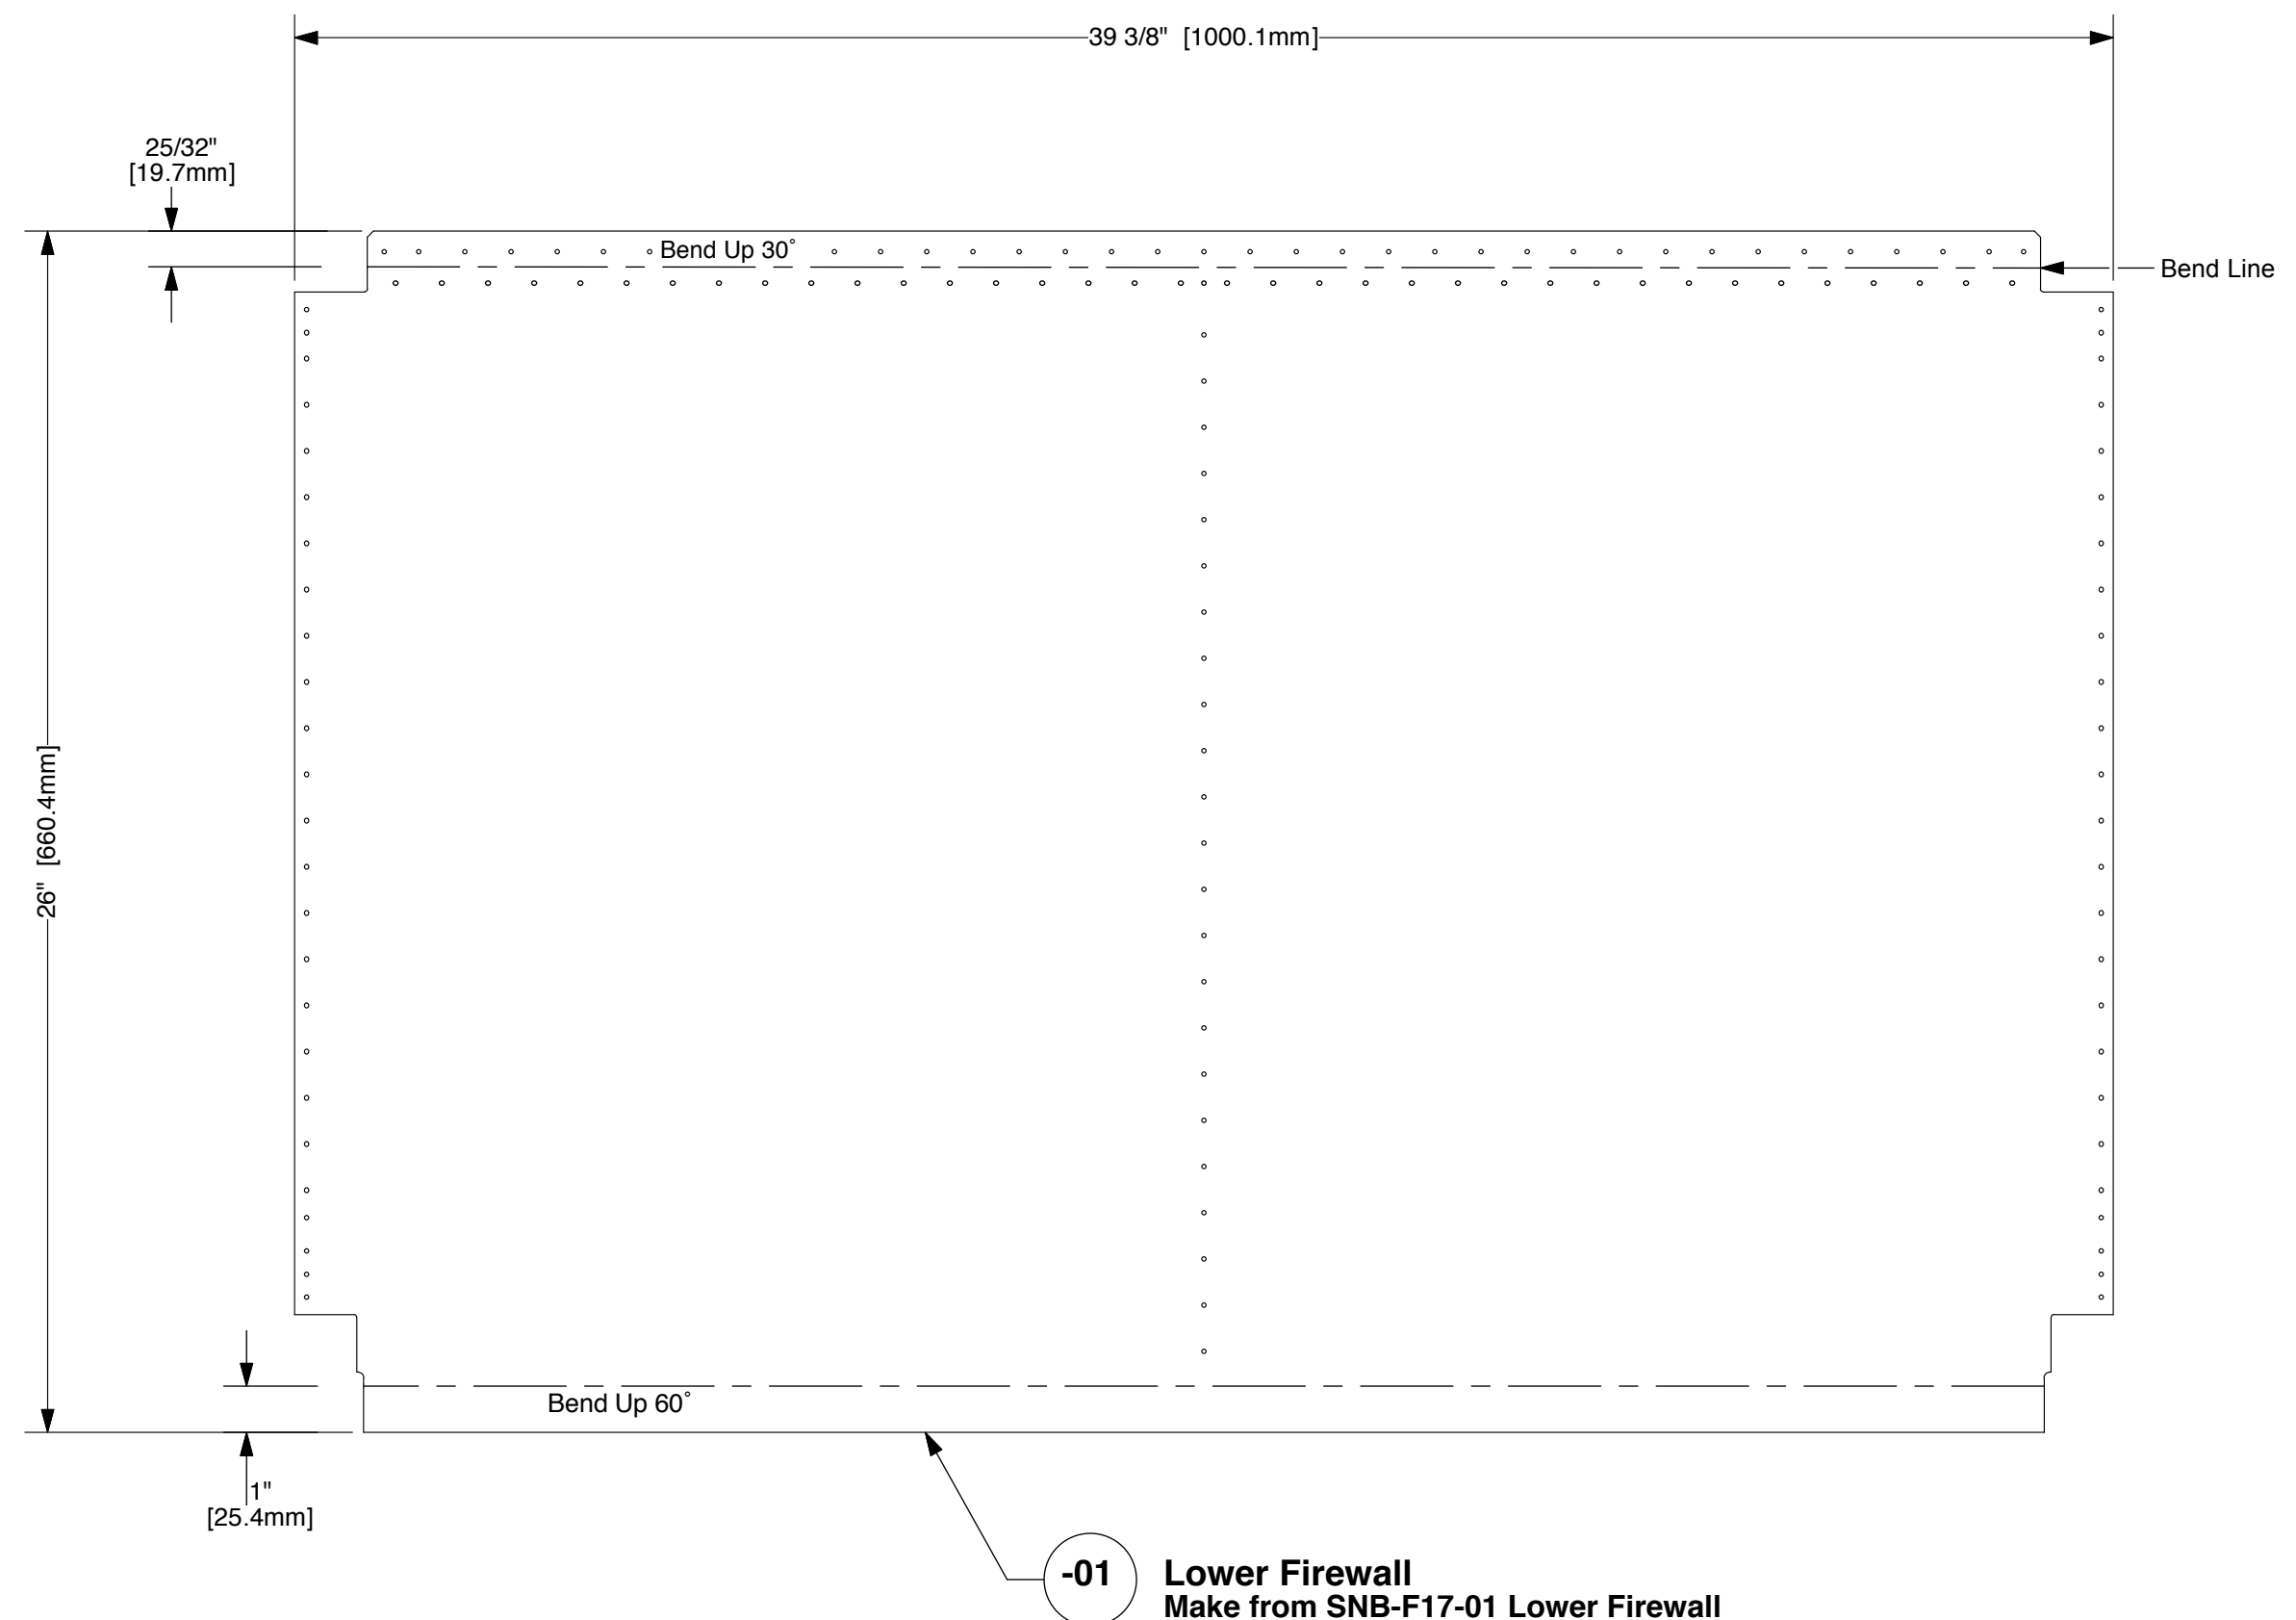
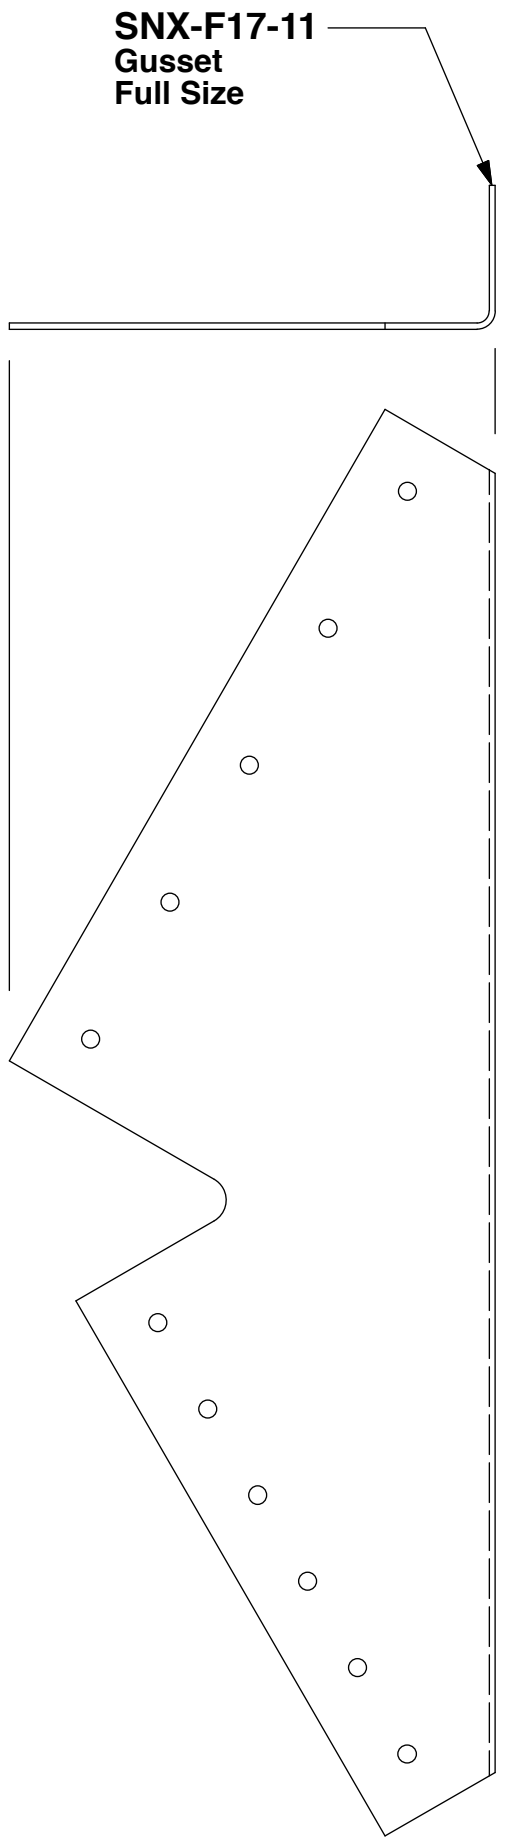
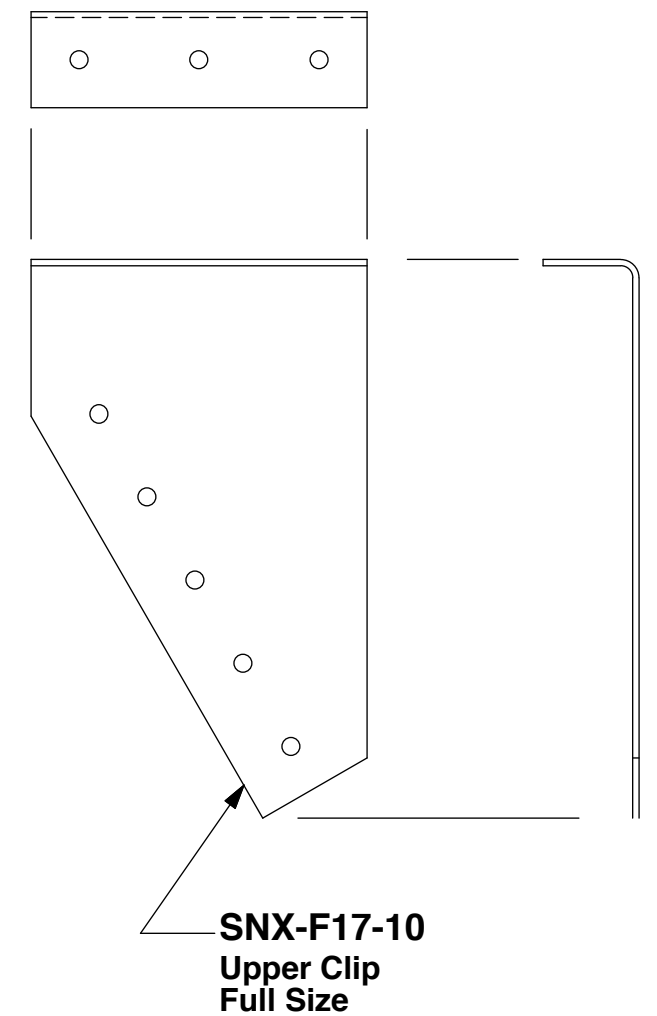


The information disclosed herein is the property of the originator who reserves all patent, design, proprietary, manufacturing, use and sales rights thereto, except for the rights expressly granted to others. This document shall not be reproduced nor shall the information contained within be used by or disclosed to others except as expressly authorized by the originator. ©

Revision Letter	Change Description	
A	Corrected -03 Upper Firewall to show that top rivet is left out until a later assembly.	09.19.2016
B	Added upper pilot and corner clearance notches to parts -03R and -03L. Added second row of pilot holes to -01. Installed rivet in top hole of -03 Assembly Corrected "Left" and "Right" hand callouts on -03.	12.02.2016

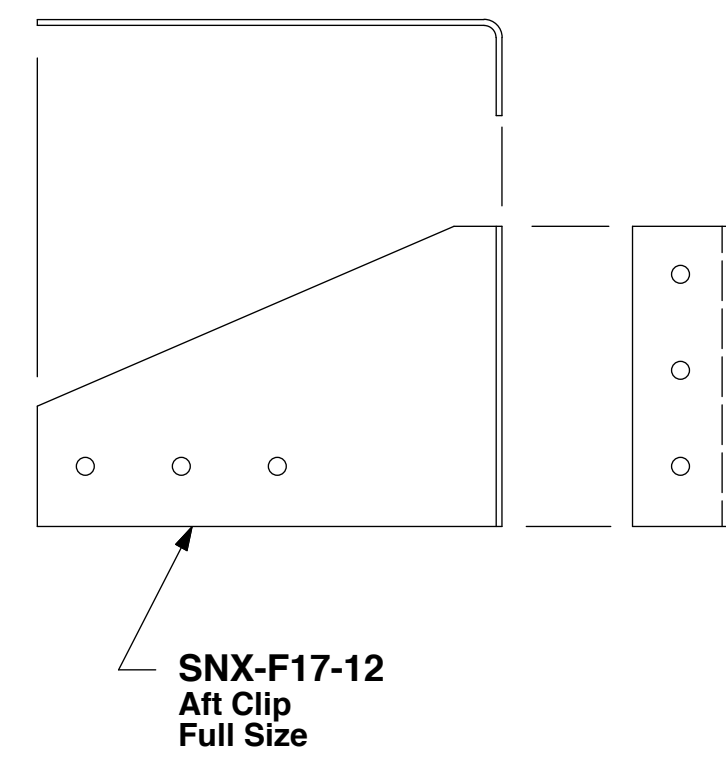

SNX-F17-12	1	Aft Clip	WXB-F11
SNX-F17-11	1	Gusset	WXB-F11
SNX-F17-10	1	Upper Clip	WXB-F11
WXB-F17-09	1	Floor Stiffener	WXB-F11
WXB-F17-08	1	Firewall Stiffener	WXB-F11
WXB-F17-03	1	Upper Firewall Assembly	WXB-F11
WXB-F17-01	1	Lower Firewall	WXB-F11
Part / Ass'y Number	Qty. Req'd	Part Title	Next Assembly

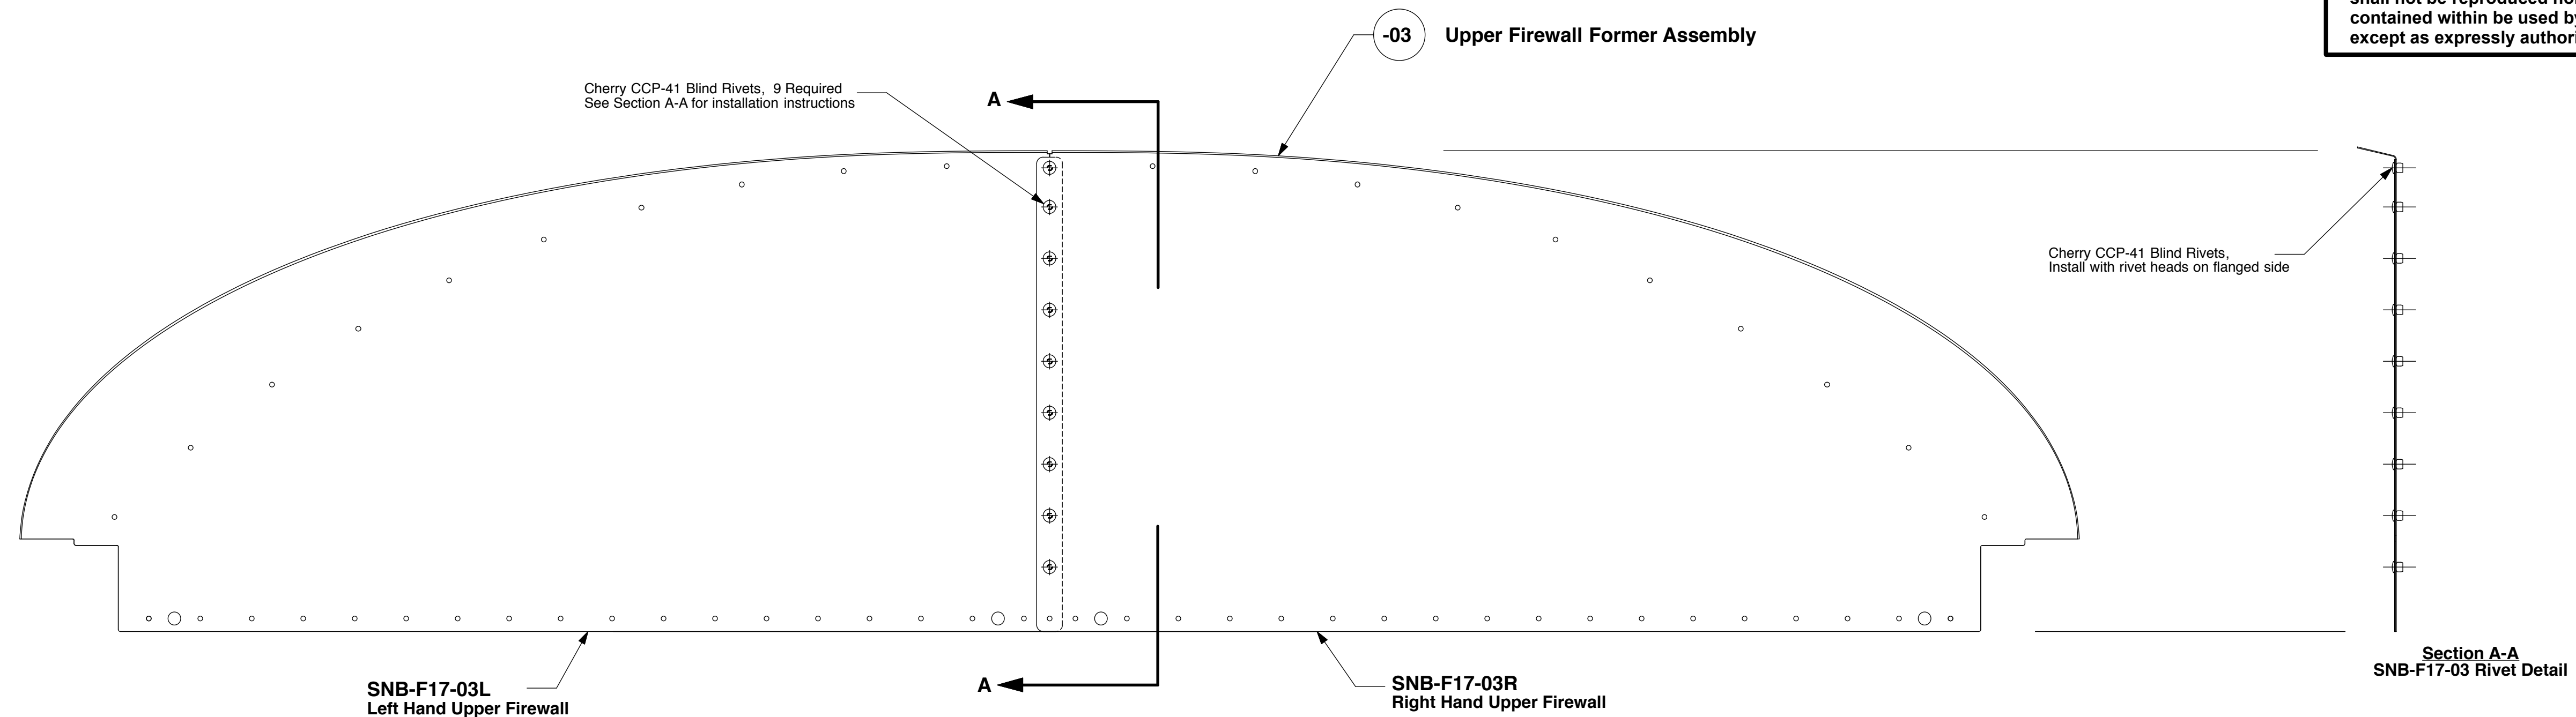